



# McGuire Manufacturing Co., Inc.

60 Grandview Court  
 Cheshire, Connecticut 06410  
 (203) 699-1801 Fax (203) 699-1813  
 customerservice@mcguiremfg.com mcguiremfg.com

## PRODUCT SPECIFICATION


**Part No.**

**8089 and 8090 Series**

**Boston Sweat P-Trap**

**Job Name:**

**Submittal Number:**

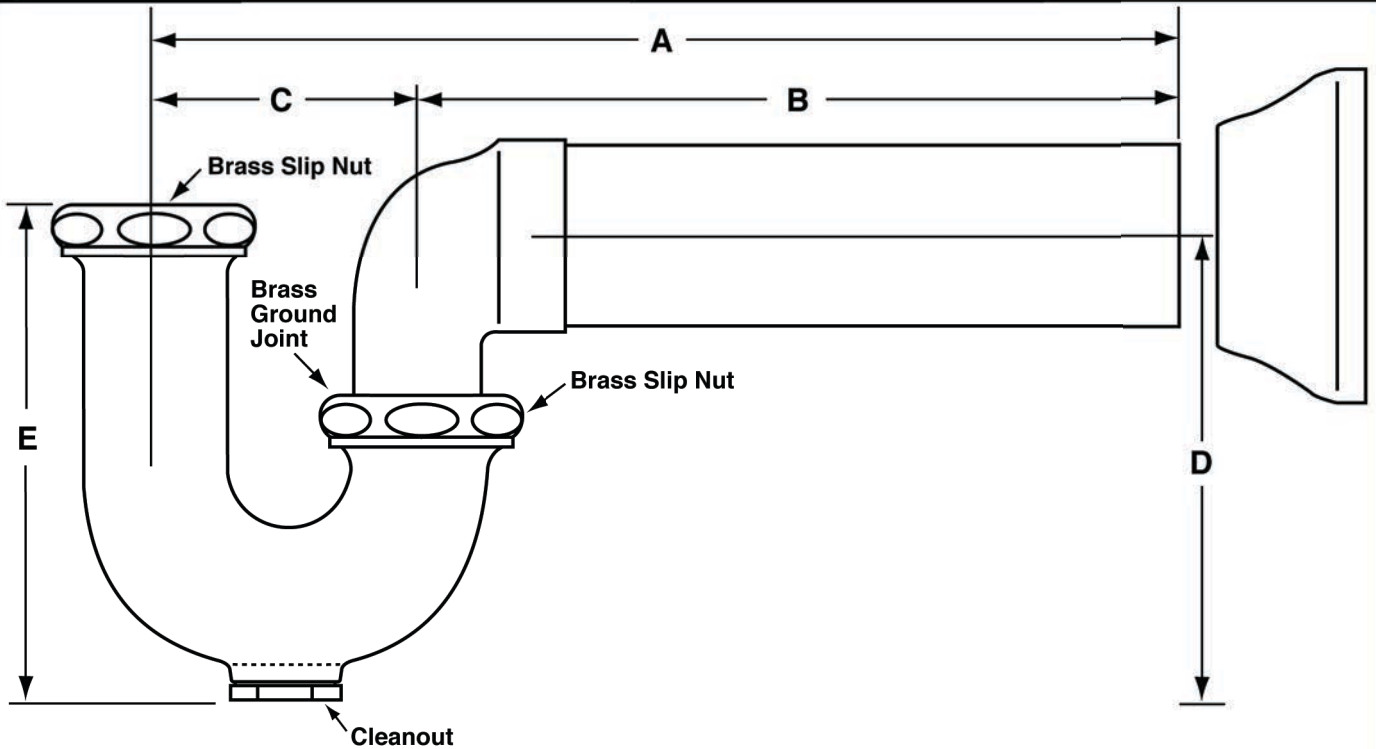

### ROUGHING MEASUREMENTS

NO.	TRAP DIMENSIONS		A	B	C	D	E
	INLET	OUTLET					
8090CBOS4	1-1/4"	1-1/2" w/4" Sweat Extension	8"	5"	3"	4-1/2"	5"
8090CBOS6	1-1/4"	1-1/2" w/6" Sweat Extension	10"	7"	3"	4-1/2"	5"
8090CBOS8	1-1/4"	1-1/2" w/8" Sweat Extension	12"	9"	3"	4-1/2"	5"
8090CBOS12	1-1/4"	1-1/2" w/12" Sweat Extension	16"	13"	3"	4-1/2"	5"
8089CBOS4	1-1/2"	1-1/2" w/4" Sweat Extension	8"	5"	3"	4-1/2"	5"
8089CBOS6	1-1/2"	1-1/2" w/6" Sweat Extension	10"	7"	3"	4-1/2"	5"
8089CBOS8	1-1/2"	1-1/2" w/8" Sweat Extension	12"	9"	3"	4-1/2"	5"
8089CBOS12	1-1/2"	1-1/2" w/12" Sweat Extension	16"	13"	3"	4-1/2"	5"

Note: Minimum seal 2"

See options and accessories section for details on product variations.



ASME A112.18.2/CSA B125.2

## Specifications:

P-Trap shall be chrome plated cast brass body with cleanout, 17 gauge seamless tubular sweat extension, cast brass ground joint elbow, and cast brass slip nuts. No reducing washers. With (shallow, deep, bell) (steel, brass) or (forged brass with set screw) flange.



### WARNING:

This product can expose you to chemicals including lead, which is known to the State of California to cause cancer, and birth defects or other reproductive harm. For more information go to [www.P65Warnings.ca.gov](http://www.P65Warnings.ca.gov).